


- 1. Scope as per Clauses 1.0 and 9.4 E2/AS1
- 2. Profiles as per NZS 3617, Branz Bulletin 411 and/or compliance achieved through in-service history, length of service not less than 15 years in all NZ environments B2/VM1 1.1.1 (a)
- 3. Fixings as per Table 24 E2/AS1
- 4. Compatibility of materials as per Tables 20-22 E2/AS1
- 5. Flashing as per Clause 4.0 E2/AS1
- $6.\ Rigid\ and\ flexible\ underlay\ as\ per\ Table\ 23\ and\ Clauses\ 9.1.5\ to\ 9.1.7\ E2/AS1\ or\ proprietary\ approved\ alternative$
- 7. All weatherboards to be factory oiled to all faces and weathergrooves prior to installation, ensure maintenance is to manufacturers recommendations
- 8. The weatherboard system relies on the joinery meeting the requirements of NZS 4211 for the relevant building windzone or wind pressure
- 9. Timber to NZBC B2 Durability B2.3.1(b), Western Red Cedar, Larch and Truwood®
- 10. Timber framing to NZS 3604:2011







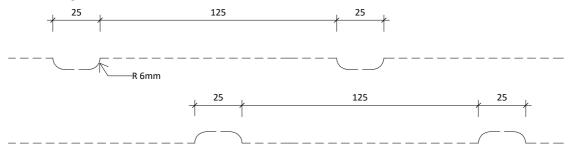

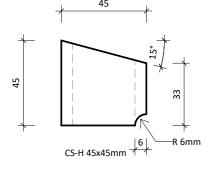


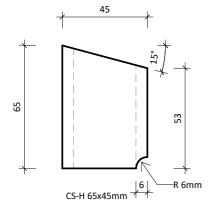

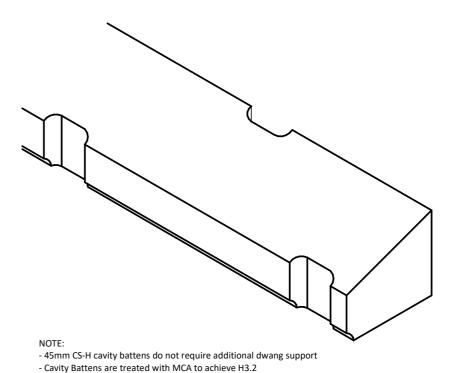

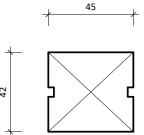



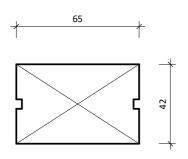

CS-V 65x42mm



www.rosenfeldkidson.co.nz

Postal address: PO Box 621, Shortland Street, Auckland 1140

## **Auckland Branch:**

T: +64 9 573 0503 F: +64 9 573 0504 513 Mt Wellington Highway Mt Wellington, Auckland 1060

## **Christchurch Branch:**

T: +64 3 349 3316 F: +64 3 349 3317 15 Edmonton Road Hornby, Christchurch 8042

**RKV 45mm Cavity Battens** 

Drawing

RKV45-BATT-01

Scale 1:2@A4

Date

12.10.2020